VINYL GRAPHIC INSTALLATION SIGNAL STATE OF THE PROPERTY OF THE



supplies needed!

- Spray Bottle with a few drops of Dawn Isopropyl Alcohol Masking Tape or Painters Tape
- Tape Measure Grease Pencil Application Squeegee Scissors or Xacto Knife Hair Dryer or Heat Gun

1. Surface Preparation


All surfaces must be thoroughly cleaned prior to installation. Wash surface with soap and water and rinse. After surface has completely dried, wipe down area with isopropyl alcohol to remove any contaminants.

2. Temperature Requirements


Surface temperatures should be between 50°-90°F to achieve the best results.

- 3. Wet Application Method this method allows you to reposition the graphic and reduces bubbles and wrinkles.
 - 1. Determine where the graphics will be applied.
 - 2. Using a ruler and grease pencil draw guidelines to help with aligning the graphic.
 - 3. With the graphic upside down on a flat clean surface remove the liner. Be careful not leave any letters on the backing liner.
 - 4. Lightly spray the back of the letters (adhesive side) and the application surface with soap and water solution.
 - 5. Position and align graphic using guidelines.
 - 6. Using a squeegee, start in the middle of the graphic and lightly squeegee out removing all air and water mixture.
 - 7. Let dry for 1 hour before removing application tape.
 - 8. Carefully remove application tape at a 180 degree angle flat against the graphic, if the graphic lifts with the tape, squeegee the graphic again and wait 15 minutes.


4. Dry Application - Center Hinge Method

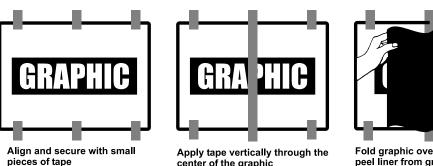

center of the graphic



Fold back and squeegee using firm overlapping strokes, start from the center and work outward, keep the graphic lifted allowing the graphic to adhere with pressure from the squeegee.

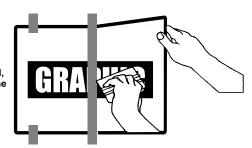



Remove remaining tape, remove remaining liner and squeegee using the same method in previous step.